


Hand Crimp Tool Krimptite™

Application Tooling Specification Sheet

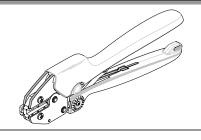

Order No. 64001-0600 Engineering No. RHT 7000

FEATURES

- A full cycle ratcheting hand tool ensures complete crimps
- % Long handles for comfortable crimping with reduced crimping force
- % A precision user-friendly terminal locator wire stop holds terminals in the proper crimping position for each of the nests
- 2-nested tool eliminates the need for additional tools

SCOPE

Products: Nylon closed end connectors 10–22 AWG (2 Nests 14 - 22 and 10 - 16).

Testing

Mechanical

The tensile test, or pull test, is a means of evaluating the mechanical properties of the crimped connections. The following charts show the UL specifications for various wire sizes. The tensile strength is shown in pounds and indicates the minimum acceptable force to break or separate the terminal from the conductor.

Wire Size (AWG)	UL – 486 C
22	8
20	10
18	10
16	15
14	25
12	35
10	40

* UL – 486 C – Closed end connectors and Wire Nuts.

The following is a partial list of the product part numbers and their specifications that this tool is designed to run. We will be adding to this list and an up to date copy is available on www.molex.com.

Torminal Order No.	Terminal Eng No. (REF)	Wi	re Size	Wire Combinations
Terminal Order No.	Terminal Eng No. (KEF)	AWG	mm²	wire Combinations
19160-0002	NC-1610	10-16	5.00-1.30	See Chart 1
19160-0003	NC-1610-BA	10-16	5.00-1.30	See Chart 1
19160-0004	NC-1610-L	10-16	5.00-1.30	See Chart 1
19160-0006	NC-1610-Y	10-16	5.00-1.30	See Chart 1
19160-0030	NC-S1610	10-16	5.00-1.30	See Chart 1
19160-0012	NC-2214	14-22	2.00-0.35	See Chart 2
19160-0013	NC-2214-BA	14-22	2.00-0.35	See Chart 2
19160-0015	NC-2214-L	14-22	2.00-0.35	See Chart 2
19160-0016	NC-2214-R	14-22	2.00-0.35	See Chart 2

Doc No. ATS-640010600 Release Date: 10-09-02 **UNCONTROLLED COPY** Page 1 of 7 Revision: F Revision Date: 12-15-10

OPERATION

Wire Preparation

Pre-twisted wire not required for OEM applications. For Solid Wire strip leads to 3/8 of an inch. Insert into connector and crimp (OEM only).




CHART 1

Wine Combinations for Notes, broadered Classed End Commenters							
Wire Combinations for Nylon- Insulated Closed End Connectors Part No. 19160-0002 (NC-1610)							
		Wire	Detin				
Wire Type	12	14	16	17	18	20	Rating
Stranded or Solid	1		1				UL & CSA
Stranded or Solid	1				1		UL & CSA
Stranded or Solid	1				2		UL & CSA
Stranded or Solid		2					UL & CSA
Stranded or Solid		1	2				UL & CSA
Stranded or Solid		1	1				UL & CSA
Stranded or Solid		1	1		1		UL & CSA
Stranded or Solid		1			3		UL & CSA
Stranded or Solid		1			2		UL & CSA
Stranded or Solid		1			1		UL & CSA
Stranded or Solid			3		1		UL & CSA
Stranded or Solid			3				UL & CSA
Stranded or Solid			2		3		UL & CSA
Stranded or Solid			2		2		UL & CSA
Stranded or Solid			2		1		UL & CSA
Stranded or Solid			2				UL & CSA
Stranded or Solid			1		4		UL & CSA
Stranded or Solid			1		3		UL & CSA
Stranded or Solid			1		2		UL & CSA
Stranded or Solid			1		1		UL & CSA
Stranded or Solid					6		UL & CSA
Stranded or Solid					5		UL & CSA
Stranded or Solid					4		UL & CSA
Stranded or Solid					3		UL & CSA

Additional UL Listed Wire Combinations

- (2) 17 AWG Solid with (1) 18 AWG Stranded.
- (3) 17 AWG Solid with (2) 18 AWG Stranded.

Additional CSA Certified Wire Combinations

(3) 16 AWG Stranded with (1) 12 AWG Solid.

CHART 2

Wire Combinations for Nylon- Insulated Closed End Connectors Part No. 19160-0012 (NC-2214)						
Wine Tune	Wire Gauge (AWG)					Detina
Wire Type	14	16	18	20	22	Rating
Stranded only		1	1			UL only
Stranded only		1	1	1	1	UL only

Wire Combinations for Nylon- Insulated Closed End Connectors Part No. 19160-0012 (NC-2214)						
Wire Type	Wire Gauge (AWG)				Rating	
	14	16	18	20	22	·
Stranded only		1		2		UL only
Stranded only		1		1		UL only
Stranded only		1			3	UL only
Stranded only		1			2	UL only
Stranded only		1			1	UL only
Stranded only			3			UL only
Stranded only			2	1		UL only
Stranded only			2		2	UL only
Stranded only			2		1	UL only
Stranded only			1	3		UL only
Stranded only			1	2		UL only
Stranded only			1	2	1	UL only
Stranded only			1	1	3	UL only
Stranded only			1	1	2	UL only
Stranded only			2			UL only
Stranded only			1	1	1	UL only
Stranded only			1		5	UL only
Stranded only			1		4	UL only
Stranded only			1		3	UL only
Stranded only				4	1	UL only
Stranded only				4		UL only
Stranded only				3	2	UL only
Stranded only				3	1	UL only
Stranded only				2	4	UL only
Stranded only				2	3	UL only
Stranded only				2	2	UL only
Stranded only				1	6	UL only
Stranded only				1	5	UL only
Stranded only				1	4	UL only
Stranded only					7	UL only
Stranded only					6	UL only
Solid only			3			UL only
Solid only			2			UL only
Stranded only					7	CSA only
Stranded only				2	4	CSA only
Stranded only		1		2		CSA only
Stranded only			2	1		CSA only
Copper Stranded only			3			CSA only


3/8"

Doc No. ATS-640010600 Release Date: 10-09-02 **UNCONTROLLED COPY** Page 2 of 7 Revision: F Revision Date: 12-15-10

Crimping Terminals


Open the tool by first closing the jaws sufficiently for the ratchet mechanism to release.

1. Hold hand tool with the locator facing up. Insert the closed end connector in the correct slot (14-22 or 10-16). Make sure that the shoulder of the connector is resting on the locator plate. See Figure 1.

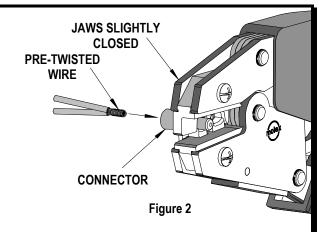

Note: The tamper proof ratchet action will not release the tool until it has been fully closed.

2. Close the hand tool jaws until the connector is held snug in place. Load the connector with the desired wire combination. See Figure 2 and 3. Complete the crimp by closing the hand tool handles until they release.

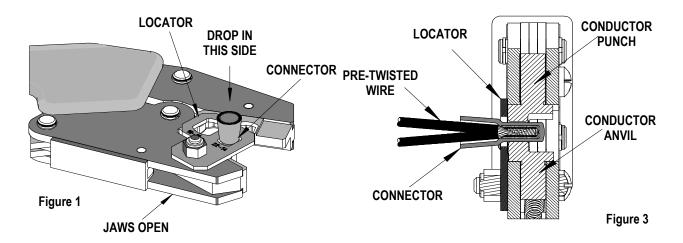

3. Remove the crimp and inspect for proper crimp location, and check for insulation closure. Molex offers a Crimp Inspection Handbook for closed barrel industrial product. See our website or contact your sales engineer.


Note: Whenever crimping without the locator, make sure the seam of the terminal is oriented up or down in the tool if using unbrazed product, as this will provide higher pull force values.

Doc No. ATS-640010600 Release Date: 10-09-02 UNCONTROLLED COPY Page 3 of 7


Maintenance

It is recommended that each operator of the tool be made aware of, and responsible for, the following maintenance steps:

- 1. Remove dust, moisture and other contaminants with a clean brush, or soft, lint-free cloth.
- 2. Do not use any abrasive materials that could damage the tool.
- Make certain all pins; pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do not oil excessively. This tool was engineered for durability, but like any fine piece of equipment it needs cleaning and lubrication for a



4. When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping dies, and store the tool in a clean, dry area.




Should this tool ever become stuck or jammed in a partially closed position, **Do Not** force the handles open or closed. The tool will open easily by pressing the ratchet release lever. See Figure 5.

How to Adjust Tool Preload (See Figure 5)


Over the life of the tool, it may be necessary to adjust tool handle preload force. Listed below are the steps required to adjust the crimping force of the hand tool to obtain proper crimp conditions:

- 1. Remove the screw and plastic cover washer. Note the setting wheel position.
- 2. Lift the setting wheel off the axle. Turn the eccentric axle with a screwdriver.
- 3. Turning the eccentric axle counterclockwise (CCW) will increase handle force.
- 4. Replace the setting wheel to the axle, aligning the nearest notch in the setting wheel to the dowel pin.
- 5. Replace the plastic cover washer and screw.
- 6. Check the crimp specifications after tool handle preload force is adjusted.

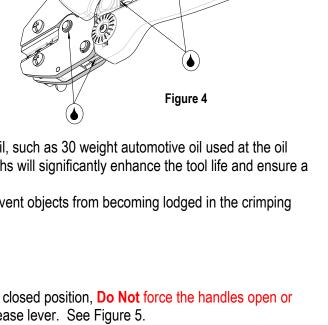

LUBRICATION POINTS (BOTH SIDES) LIGHT OIL (EVERY 3 MONTHS OR


5,000 CRIMPS)

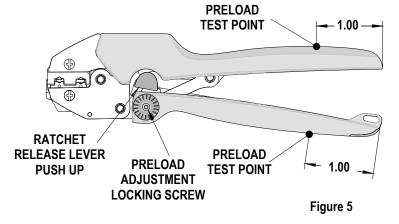

Doc No. ATS-640010600 Release Date: 10-09-02 UNCONTROLLED COPY Page 4 of 7

Tool Calibration

A Certificate of Calibration (see last page) was supplied with the tool. To recalibrate this tool, pin gauge measurements should be taken in each conductor nest and compared to this chart. The tool should be lubricated prior to recalibration to ensure consistent measurements. Handle preload is factory set to 25-45 LBS. See How to Adjust Tool Preload (See Figure 5) to recalibrate.

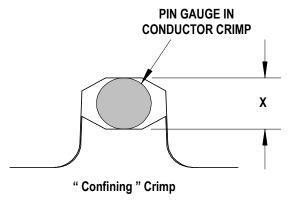

Wire Range			Dimen ductor (
Awg	mm²	Mean	Go	No Go
14 - 22	0.35 - 2.00	.100	.096	.104
10 - 16	1.30 - 5.00	.120	.116	.128

Warranty

Caution: Repetitive use of this tool should be avoided.

This tool is for electrical terminal crimping purposes only. This tool is made of the best quality materials. All vital components are long life tested. All tools are warranted to be free of manufacturing defects for a period of **30 days.** Should such a defect occur, we will repair or exchange the tool free of charge. This repair or exchange will not be applicable to altered, misused or damaged tools. This tool is designed for hand use only. Any clamping, fixturing, or use of handle extensions voids this warranty.

Hand held crimping tools are intended for low volume, prototyping, or repair requirements only.


CAUTION: Molex crimp specifications are valid only when used with Molex terminals, applicators and tooling.

Doc No. ATS-640010600 Release Date: 10-09-02 **UNCONTROLLED COPY** Page 5 of 7 Revision: F Revision Date: 12-15-10

PARTS LIST

Item	Order No	Description	Quantity
	64001-0600	Hand Crimp Tool	Figure 6
1	64000-0076	Repair Kit (Springs, Pins and E-Rings)	1
2	63810-0000	Handle	1
3	64001-0675	Locator Assembly	1
4	64001-0670	Tooling Kit	1
	-	Tooling Kit Only	
5	64001-0601	Conductor Punch	1
6	64001-0602	Conductor Anvil	1

^{**} The following purchased parts are available from an Industrial supply company such as MSC (1-800-645-7270).

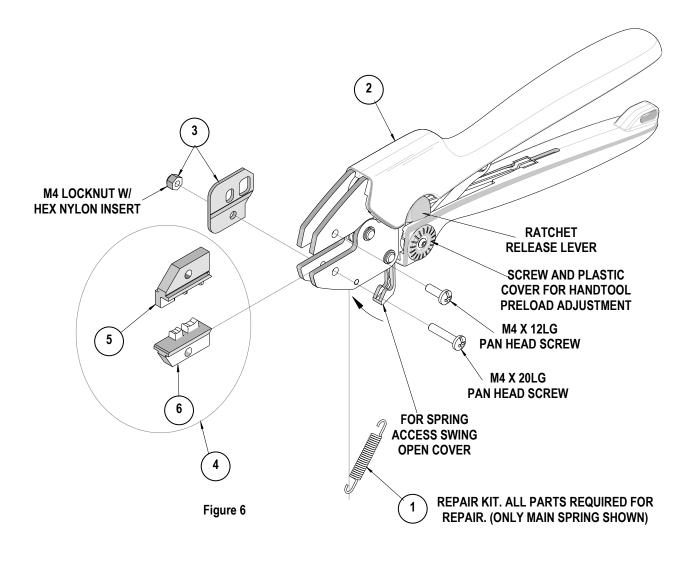


Doc No. ATS-640010600 Release Date: 10-09-02 **UNCONTROLLED COPY** Page 6 of 7



Hand Crimp Tool Krimptite ™

Certificate of Calibration

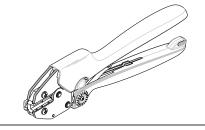

Order No. 64001-0600 Engineering No. RHT 7000

Tool Order Number	<u> </u>
Tool Eng. Number	_
Tool Revision	_
Serial Number	
Date of Manufacture	_
H	andle Load Range at 1 inch from the Tips =
	Actual =
Pin Gauge of Conductor Nest/Nests or Slug	height if the nest is the "F" Crimp style.
Range Conductor Nest # 1 =	Actual =
Range Conductor Nest # 2 =	Actual =
Technician	
Date of Calibration	
Calibration should be done every 5,000 cycle Tools should be lubricated during this operate	

Doc No. ATS-640010600 Release Date: 10-09-02 **UNCONTROLLED COPY** Page 7 of 7

http://www.molex.com